


RXW Temperature/RH Sensor (RXW-THC-B-xxx) Quick Start

Adding a Sensor Node to the HOBOnet® Wireless Sensor Network

Important: Keep the sensor node near the station while completing these steps.


If you are setting up a new station, follow the instructions in the station quick start before setting up this mote: [HOB0 MicroRX Station for HOBOnet \(RX2105 and RX2106\) Quick Start](#) or [HOB0 RX3000 Remote Monitoring Station Quick Start Guide](#).

1

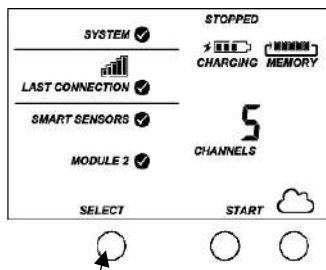


Press the Select button to switch to the module with the manager (module 2 on RX2105 or RX2106 stations).

2

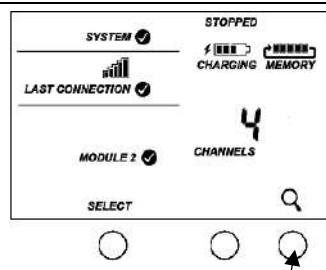

Press the Search button. The magnifying glass icon blinks while the station is in search mode waiting for sensor nodes to join the network.

3

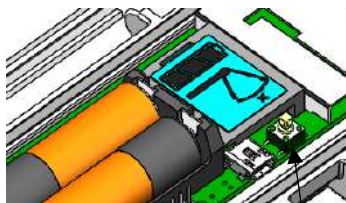

Open the sensor node door and install the batteries if you have not already done so. Press the button on the sensor node for 3 seconds.

4

Watch the sensor node LCD while it joins the network:

a.



The signal strength icon blinks while the sensor node searches for a network.

b.



Once the sensor node finds a network is found, the icon stops blinking and the bars cycle from left to right.

c.




This network connection X icon blinks while the sensor node completes the registration process, which may take up to five minutes.

d.



Once the sensor node has finished joining the network, the X icon disappears and the channel count on the station LCD increases by three (two for temperature/RH and one for the sensor node battery).

5

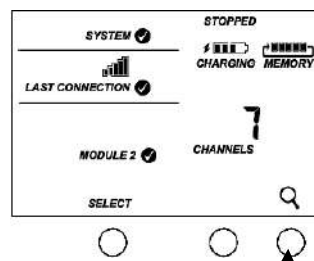

Press the Search button on the station again to stop the search for sensor nodes.


6

Go to www.hobolink.licor.cloud to monitor sensor node status and health. See the [HOBOLink Online Help](#) for details.

Installing the Bracket and Sensor Node


1

Orient the bracket so the text TOP is facing upwards.

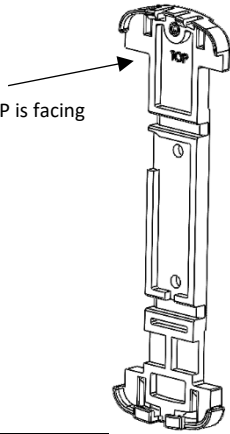


2

To install the bracket onto a wall, use the two long screws included in the package. Screw the bracket to a wall using the two holes on the mid-section of the bracket.

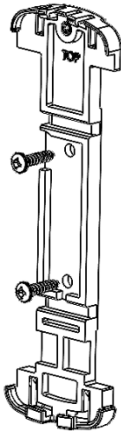


3

To install the bracket onto a pole, slip a cable tie through each of the channels on the bracket and fasten the tie around the pole.

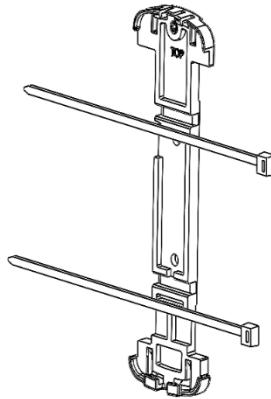


4

Insert the bottom of the sensor node into the retaining clips on the bottom of the bracket then press the top of the sensor node into the clips at the top of the bracket.

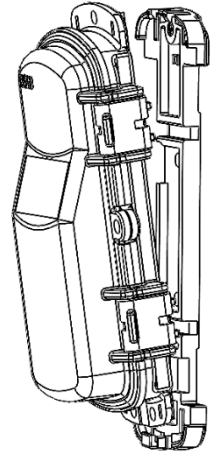

5

Use the short screw included in the package to fasten the sensor node to the bracket.

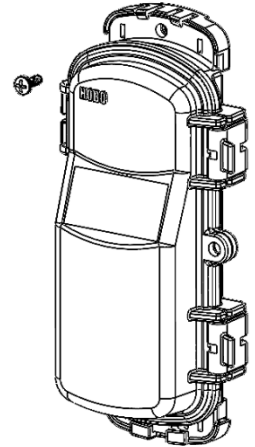

6

Close the sensor node and use a padlock to keep it secure.
Note: Ensure that the node seal is clean from foreign debris.

Mounting and Positioning the Sensor node

- Make sure the sensor node is mounted a minimum of 1.8 m (6 feet) from the ground to help maximize distance and signal strength.
- Consider using plastic poles such as PVC to mount the sensor node as certain types of metal could decrease the signal strength.
- Place the sensor node so there is full line of sight with the next sensor node. Use a repeater if there is an obstruction between sensor nodes.
- There should not be more than five sensor nodes in any direction from a repeater or the manager. Data from sensor nodes travels or “hops” across the network and may not reach the station if the sensor node is more than five hops away.



For specifications, complete mounting guidelines, and other details about this sensor node, see [RXW Temperature/RH Sensor Manual](#) or scan the code at left.



U.S. and International Sales: 1-508-759-9500
www.onsetcomp.com/contact/support

© 2024 Onset Computer Corporation. All rights reserved. Onset, HOB0, and HOBOLink are registered trademarks of Onset Computer Corporation. All other trademarks are the property of their respective companies. This product has been manufactured by Onset Computer Corporation and in compliance with Onset's ISO 9001:2015 Quality Management System.
24381-D MAN-RXW-THC-B-QSG